# weibull Documentation

Release 0.0

Jason R. Jones

## Contents

1	Installation  1.1 Using pip	1 1 1 1 1
2	Analysis 2.1 Fitting 2.2 Plotting 2.3 Class Documentation	3 4 7
3	<del> </del>	<b>11</b> 11
4		<b>13</b> 13
5	5.1 Determining $\beta$ and $\eta$ Values	15 16 16 17 17
6	·	<b>21</b> 21
7	7.1 Weibull Distribution	27 27 31 31 32 32
8	Introduction	35
9	Installation	37

	9.1 Dependencies	37
10	Test Coverage	39
11	1 Classes	41
Ind	ndex	43

Installation

### 1.1 Using pip

Ideally, you should be able to pip install weibull and simply be finished. This package is a pure-python package, so it should work on any os. Unfortunately, this package utilizes other packages which may be more difficult to install. Please consult package documentation for more details.

This user had the most issues installing statsmodels in a Windows 10 environment. Other package dependencies - numpy, pandas, and matplotlib - installed without issue.

### 1.2 Using setup.py

Additional dependencies are utilized by calling python setup.py install which ensure that the environment is appropriately set up for development. For instance, the additional dependencies are flake8, pytest, and sphinx.

Simply download a copy of the repository, cd into the directory, and python setup.py install.

### 1.3 Using conda

If you are having installation issues, perhaps try the Anaconda distribution! As I understand it, they have solved most of these installation problems for difficult packages!

### 1.4 Dependencies

For most installations, you must have pandas, numpy, matplotlib, and scipy properly installed into your environment.

**Analysis** 

The Analysis class is the primary class which will provide methods for analyzing your life data. This class is designed to take your data and calculate  $\beta$  and  $\eta$  values along with generating any appropriate plots for display of your data.

A typical use case of the Analysis case is as follows:

```
import weibull

# fail times include no censored data
fail_times = [
    9402.7,
    6082.4,
    13367.2,
    10644.6,
    8632.0,
    3043.4,
    12860.2,
    1034.5,
    2550.9,
    3637.1
]

# this is where the actual analysis and curve fitting occur
analysis = weibull.Analysis(fail_times, unit='hour')
```

### 2.1 Fitting

The fit () method is used to calculate appropriate  $\beta$  and  $\eta$  values, which are then stored into the class instance. When fit () is called with no parameters, then the linear regression method of calculation is assumed:

```
analysis.fit()
```

An alternative method is to use the Maximum Likelihood Estimation (MLE) method of fitting  $\beta$  and  $\eta$  to the data. This may be done by specifying that the method='mle':

```
analysis.fit(method='mle')
```

In many cases, the mle and lr methods will yield very similar values for  $\beta$  and  $\eta$ , but there are some cases in which one is preferred over the other. It turns out that linear regression tends to work best for very low sample sizes, usually less than 15 while the maximum likelihood estimator works best for high sample sizes. In both cases, the probplot () method should be used to verify that the data is a good fit.

To retrieve the  $\beta$  and  $\eta$  values, simply use the instance variables beta and eta:

```
print(f'beta: {analysis.beta: .02f}')
print(f'eta: {analysis.eta: .02f}')
```

When using the fit () method, it is also possible to set the confidence levels

Use the stats () method to get a pandas. Series containing most internal estimates:


```
$> analysis.stats
fit method
                   maximum likelihood estimation
confidence
                                               0.6
beta lower limit
                                           2.42828
beta nominal
                                           2.97444
beta upper limit
                                           3.64344
eta lower limit
                                           186.483
eta nominal
                                           203.295
eta upper limit
                                           221.622
mean life
                                            181.47
median life
                                           179.727
b10 life
                                            95.401
dtype: object
```

### 2.2 Plotting

One of the most often requested features of such a package is plotting the data, particularly in Jupyter Notebooks. The weibull package comes with built-in methods to easily display and save standard plots with one-line methods.

Building on the analysis instance above, we will examine the probability plot:

```
analysis.probplot()
```

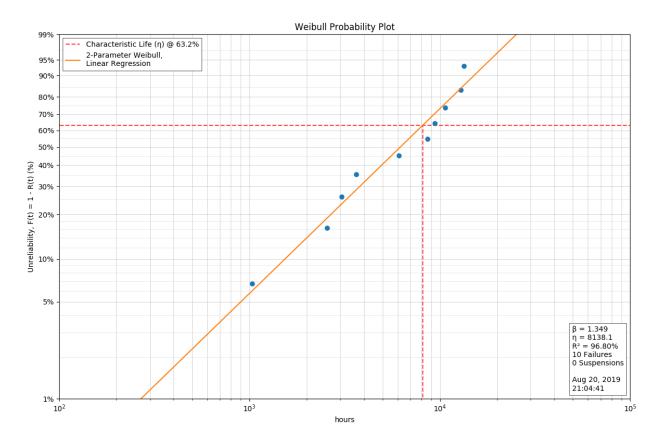

There are some settings for the Weibull probability plots that will allow the user to add more information to the plot itself that are useful when the plot will be included in reports, on web pages, or other situations where the supporting information may not always accompany the plot. These include being able to specify the Analyst's name and/or the Company or Organization name:

```
analysis.analyst = 'John Q. Smith'
analysis.company = 'Smith & Smith Engineering'
```

It should be noted that if either the Analyst or Company name is especially long, the annotation box (where they are displayed) will expand to fit the text which could obscure some portions of the Weibull plot. To address this, you can place a line feed '\n' within either name which will force the text to wrap to a shorter length. These must be defined before calling the probplot function.

Also, the user can now provide their own more descriptive title for the plot, use the default title, or suppress the title altogether, as follows:

```
analysis.plot_title = 'Weibull Analysis of Golden Widget Failures'
```

Setting the title to a zero-length string (or not defining one at all) will cause the default title of 'Weibull Probability Plot' to be used. Setting the title to None will suppress the title line altogether. Any other value set for analysis. plot\_title will be displayed on the Weibull plot. This too must be defined before calling the probplot function.

By default, the probability plot will now be 12 inch x 8 inch ( $1200 \times 800$  pixels) to better display enhancements made to the plot format, but it is also possible to change the size of the plot to a different size or aspect ratio by specifying the figsize:


```
plt.figure(figsize=(8, 6))
analysis.probplot()
```

2.2. Plotting 5

where the values of 8 and 6 are in inches (at 100px/inch). Be aware that generating plots smaller than the default size may result in the Y-Axis labels overlapping one another (especially when analyzing very large data sets), or the annotation box might covering some portion of the Weibull plot or the Characteristic Life line. You may have to experiment with the size values to get a satisfactory result, and you may also need to use the image resizing features when inserting the image into a document or presentation.

We can also examine a number of other common function plots (only the hazard plot is shown, but the others are along the same line):

```
analysis.pdf()
analysis.sf()
analysis.hazard()
analysis.cdf()
```

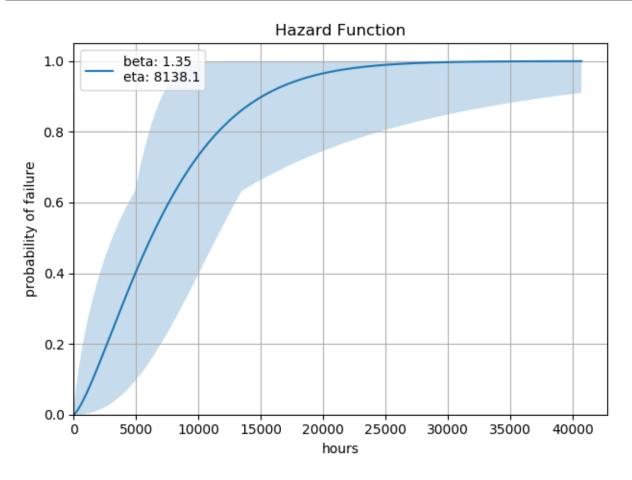

Each of these functions will generate a plot that is suitable for publication or insertion into a Jupyter Notebook. Again, note that some of these methods - such as hazard() and cdf() will produce the same plot with slightly different labeling.

### 2.2.1 Confidence Levels

Some plots will contain a shaded region which reflects the confidence\_levels. The confidence levels are calculate for  $\beta$  and  $\eta$  and the min/max values for  $\beta$  and  $\eta$  are explored rather than all possible values. As a result, the visualizations shown are an approximation of the confidence limits.

### 2.3 Class Documentation

**class** weibull. **Analysis** (*data: list, suspended: list = None, unit: str = 'cycle'*)

Calculates and plots data points and curves for a standard 2-parameter Weibull for analyzing life data.

#### **Parameters**

- data A list or numpy array of life data, i.e. [127, 234, 329, 444]
- **suspended** A list or numpy array of suspensions as boolean values, i.e. [False, False, True, True]. At any point which indicates True means that the test was stopped or that the item was removed from the test before the item failed.
- unit The unit ('hour', 'minute', 'cycle', etc.). This is used to add some useful information to the visualizations. For instance, if the unit is hour, then the x-axis will be labed in hours.

#### Variables

- **beta** The current value of the shape parameter,  $\beta$ . This value is initially set to None. The proper value for beta will be calculated on call to the fit () method. The user may also set this value directly.
- **eta** The current value of the scale parameter,  $\eta$ . This value is initially set to None. The proper value for beta will be calculated on call to the fit () method. The user may also set this value directly.
- **fit test** Basic statistics regarding the results of fit (), such as  $R^2$  and P-value.

**b** (percent\_failed: (<class 'float'>, <class 'str'>) = 10.0)

Calculate the B-life value

**Parameters** percent\_failed – the number of elements that have failed as a percent (i.e. 10)

**Returns** the life in cycles/hours/etc.

**cdf** (show: bool = True, file\_name: str = None, watermark\_text=None)

Plot the cumulative distribution function

#### **Parameters**

- show True if the plot is to be shown, false if otherwise
- file\_name the file name to be passed to matplotlib.pyplot.savefig
- watermark\_text the text to include as a watermark

#### Returns None

### characteristic life

Returns the current characteristic life of the product, aka  $\eta$ 

**Returns** the characteristic life of the product

### failures

Returns the number of failures in the data set.

**Returns** the number of failures in the data set

**fit** (*method*: str = 'lr', *confidence\_level*: float = 0.9)

Calculate  $\beta$  and  $\eta$  using a linear regression or using the maximum likelihood method, depending on the 'method' value.

### **Parameters**

- method 'lr' for linear estimation or 'mle' for maximum likelihood estimation
- **confidence\_level** A number between 0.001 and 0.999 which expresses the confidence levels desired. This confidence level is reflected in all subsequent actions, especially in plots, and can also affect several internal variables which are shown in stats.

### Returns None

**fr** (*show: bool = True, file\_name: str = None, watermark\_text=None*)

Plot failure rate as a function of cycles

#### **Parameters**

- show True if the item is to be shown now, False if other elements to be added later
- file\_name if file\_name is stated, then the probplot will be saved as a PNG
- watermark text the text to include as a watermark

#### Returns None

**hazard** (*show: bool = True, file\_name: str = None, watermark\_text=None*)

Plot the hazard (CDF) function

#### **Parameters**

- show True if the plot is to be shown, false if otherwise
- file\_name the file name to be passed to matplotlib.pyplot.savefig
- watermark text the text to include as a watermark

#### Returns None

#### mean

Calculates and returns mean life (aka, the MTTF) is the integral of the reliability function between 0 and inf,

$$MTTF = \eta \Gamma(\frac{1}{\beta} + 1)$$

where gamma function,  $\Gamma$ , is evaluated at  $\frac{1}{\beta+1}$ 

**Returns** the mean life of the product

#### median

Calculates and returns median life of the product

Returns The median life

#### mttf

Calculates and returns mean time between failures (MTTF)

**Returns** the mean time to failure

**pdf** (*show: bool = True, file\_name: str = None, watermark\_text=None*)

Plot the probability density function

#### **Parameters**

- **show** True if the plot is to be shown, false if otherwise
- file\_name the file name to be passed to matplotlib.pyplot.savefig
- watermark\_text the text to include as a watermark

#### Returns None

**probplot** (*show: bool = True, file\_name: str = None, watermark\_text=None, \*\*kwargs*)

Generate a probability plot. Use this to show the data points plotted with the beta and eta values.

#### **Parameters**

- show True if the plot is to be shown, false if otherwise
- file\_name the file name to be passed to matplotlib.pyplot.savefig
- watermark\_text the text to include on the plot as a watermark
- kwargs valid matplotlib options

#### Returns None

### r\_squared

Returns the r squared value of the fit test

Returns the r squared value

**sf** (*show: bool = True, file\_name: str = None, watermark\_text=None*)

Plot the survival function

#### **Parameters**

- **show** True if the plot is to be shown, false if otherwise
- file\_name the file name to be passed to matplotlib.pyplot.savefig
- watermark\_text the text to include as a watermark

#### Returns None

#### stats

Returns the fit statistics, confidence limits, etc :return: a pandas series containing the fit statistics

### suspensions

Returns the number of suspensions in the data set.

Returns the number of suspensions in the data set

Design

The Design class is used to design a test based on certain assumptions.

A typical example of use:

### 3.1 Class Documentation

```
class weibull.Design(target_cycles: (<class 'int'>, <class 'float'>), reliability: float = 0.9, confi-
dence_level: float = 0.9, expected_beta: float = 2.0)
```

Will determine the required test time required given the number of units under test and the target cycles OR it will determine the number of units given the test time and the target cycles.

#### **Parameters**

- target\_cycles The target number of cycles/minutes/hours
- reliability The fraction of units still running after target\_cycles, 0.001 to 0.999
- confidence\_level The fractional level of confidence, 0.001 to 0.999

• **expected\_beta** – The anticipated level of beta - often worse-case - based on historical data or other assumptions

num\_of\_cycles (number\_of\_units: int)

Design a test, calculating the test duration/cycles to prove the required reliability at target\_cycles.

**Returns** the required duration or cycles

num\_of\_units (test\_cycles: (<class 'int'>, <class 'float'>))

Design a test, calculating the number of units required to run for the test duration / cycles in order to prove the reliability at target\_cycles.

Returns The number of units required

12 Chapter 3. Design

## Weibayes

### 4.1 Class Documentation

**class** weibull. **Weibayes** (*data: list, confidence\_level: float = None, beta: float = 2.0*) Weibayes-style analysis of the data with a confidence level and beta.

### **Parameters**

- data The data for each unit
- confidence\_level The fractional level of confidence, 0.001 to 0.999
- **beta** The shape parameter

**b** (*b\_spec: int* = 10, *confidence\_level: float* = *None*)

Calculates the B-life

#### **Parameters**

- **b\_spec** the B-specification (for instance, '10')
- confidence\_level the confidence level (usually between 0.01 and 0.99)

Returns the B life

**plot** (*confidence\_level: float = None*, *show: bool = True*, *file\_name: str = None*) Plot the linear plot line.

Confidence level the desired confidence level

**Show** True if the plot is to be shown

File\_name Save the plot as "file\_name"

Examples

### 5.1 Determining $\beta$ and $\eta$ Values

Before any suppositions may be gathered, it is appropriate to calculate  $\beta$  and  $\eta$  values. Once we are satisfied that  $\beta$  and  $\eta$  match the raw data, we can move on to determining useful life characteristics for the product.

### 5.1.1 Example 1: Complete Test Data

In this example, we will take a complete set of failure data that has no censorship and apply basic weibull analysis tool suite in order to achieve a simple, accurate, and useful analysis.:

```
import weibull
# fail times include no censored data
fail_times = [
    9402.7,
   6082.4,
   13367.2,
   10644.6,
   8632.0,
    3043.4,
    12860.2,
    1034.5,
    2550.9,
    3637.1
]
# this is where the actual analysis and curve fitting occur
analysis = weibull.Analysis(fail_times,
                             unit='hour')
analysis.fit(method='mle')
```

(continues on next page)

(continued from previous page)

```
analysis.probplot()
```

In this example, we chose to use the Maximum Likelihood Estimation method of estimating  $\beta$  and  $\eta$ , which is shown in the analysis.fit (method='mle) line. If the fit () method were called with no parameters, it would - by default - have used linear regression.

By examining the probability plot, we can visually determine if the  $\beta$  and  $\eta$  are appropriately calculated.

By specifying a file name, the probability plot can be saved to a file analysis.probplot (file\_name='prob.png'). This is optional, of course, and not required.

### 5.1.2 Example 2: Right-Censored Data

Often, it is necessary to use only the smallest amount of data in order to calculate the values for  $\beta$  and  $\eta$ . For instance, a long-running test might have 10 units on the test bench, but only 3 of them have failed. When the data is so small, the default linear regression fit method is probably going to yield better results than the maximum-likelihood estimation:

Again, we plot the raw data points against the calculated  $\beta$  and  $\eta$  in order to ensure that the linear regression is an appropriate fit for the data. As more failures occur, more accurate curve fits may be run.

### 5.2 Life Calculations

Once  $\beta$  and  $\eta$  are determined, then they may be utilized to obtain the basic lifetime data that may be utilized for planning. One common reliability metric is the *B-Life*. Obtaining a B10 life using the analysis object is trivial:

```
print(f'B10 life: {analysis.b(10):.0f}')
```

As you can see, simply calling the b () function with the appropriate number as the parameter will return the B-life based on  $\beta$  and  $\eta$ .

### 5.3 Basic Life Statistics

For user convenience, the mean, median, characteristic\_life, and mttf are defined as attributes of the class and may be called at any time after an initial curve fit. Note that there is some overlap with other class vari-

ables. For instance, the characteristic\_life happens to be the same thing as eta, but if a customer asks for the characteristic life, then having this available makes the code more readable and correspond more closely to the specification.

### 5.4 Plotting

We can also plot various functions of interest, such as the survival function and hazard functions, amongst others.:

```
analysis.pdf()  # probability density function
analysis.sf()  # survival function
analysis.hazard()  # hazard function
analysis.cdf()  # cumulative distribution function
analysis.fr()  # failure rate
```

Each of these will generate a plot of the function. For all plotting methods, if file\_name is specified as a parameter, then the method will save to a file rather than display. For instance:

```
analysis.sf(file_name='survival_function.png')
```

### 5.5 Test Design

The Design class is to be utilized for two scenarios:

- · determine the required number of units to prove the target reliability given a test cycles/duration
- determine the required number of cycles/duration to prove the target reliability given a number of units

To begin, first import and instantiate the Designer, which is the utility for the test designer. There are several parameters to consider and all of them are requirements or assumptions that must be entered as parameters for the Designer class:

- target\_cycles the target to be proven in hours/days/weeks/cycles
- reliability defaults to 0.9
- confidence\_level defaults to 0.95
- expected\_beta an initial assumption for beta (defaults to 2)

Shown are two example calculations for a target lifetime of 10000 hours with a reliability of 0.9 at a confidence level of 0.5 and beta assumption of 1.5:

5.4. Plotting 17

### 5.6 Weibayes Analysis

Use Weibayes analysis to assist with designing your test or evaluating reliability within a certain confidence interval based on historical data.

You have a product that needs to be tested to B2 life of 40 million time units with a confidence limit of 95%. The product had an expected beta of 2 (lots of historical data there). B2 life is the same as 98% survival.

Using the weibull test *Design* class, we need to run 62 units (the limit of our test rig) for 62 million time units with no failures:

```
import weibull

designer = weibull.Design(
    target_cycles=40e6,
    reliability=0.98,
    confidence_level=0.95,
    expected_beta=2
)

print(f'Minimum hours for 62 units: {designer.num_of_cycles(num_of_units=62)}')
```

#### Result:

```
61860134.45191945
```

Weibayes analysis on the data would arrive at the same result.:

```
import weibull

# we want N units to run for H hours each
N = 62
H = 62.0e6


run_times_desired = [H] * N
weibayes = weibull.Weibayes(run_times_desired, confidence_level=0.95, beta=2)
print(f'B2 life: {weibayes.b(2)}')
```

### Results:

```
B2 life: 40090439.86038491
```

Note that this B2 matches very closely with target\_cycles value found in the above iteration of the Design class.

We can further plot the data using weibayes.plot() resulting in:

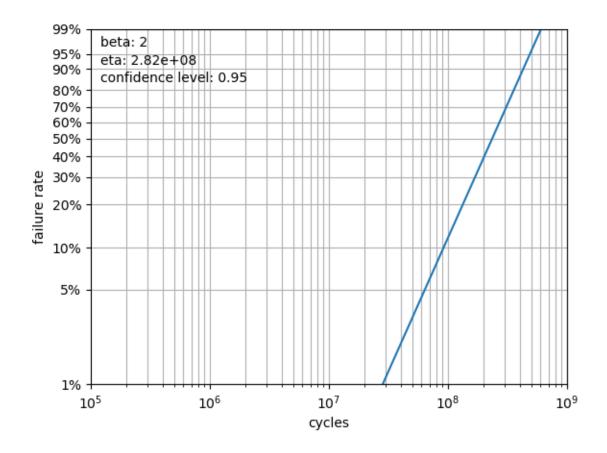


Gallery


### 6.1 Example 1: Multiple-Censored Data


The code:

```
import weibull
fail\_times = [
   42.1, 105.9, 151.3, 195.6,
    77.8, 117.0, 157.3, 207.0,
    83.3, 126.9, 163.8, 215.3,
    88.7, 138.7, 177.2, 217.4,
    101.8, 148.9, 194.3, 258.8
suspensions = [1, 0, 1, 1,
               0, 0, 0, 0,
               1, 0, 0, 1,
               1, 0, 1, 0,
               0, 0, 1, 1]
# this is where the actual analysis and curve fitting occur
analysis = weibull.Analysis(fail_times, suspensions, unit='hour')
analysis.fit(method='mle', confidence_level=0.6)
print(analysis.stats)
analysis.probplot(file_name='gallery-probplot.png')
analysis.pdf(file_name='gallery-pdf.png')
analysis.hazard(file_name='gallery-hazard.png')
analysis.sf(file_name='gallery-survival.png')
analysis.fr(file_name='gallery-fr.png')
```

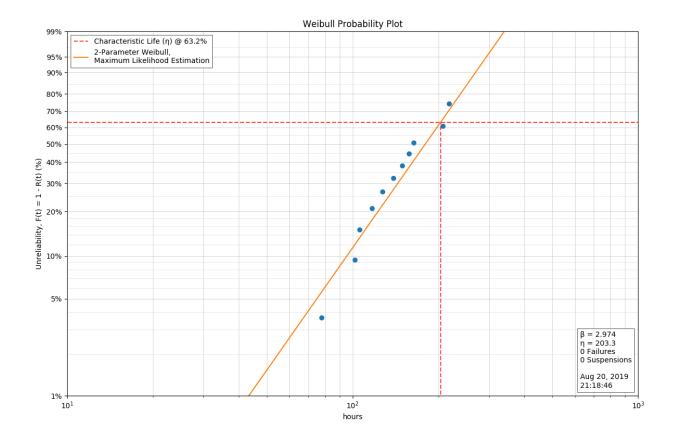



22 Chapter 6. Gallery

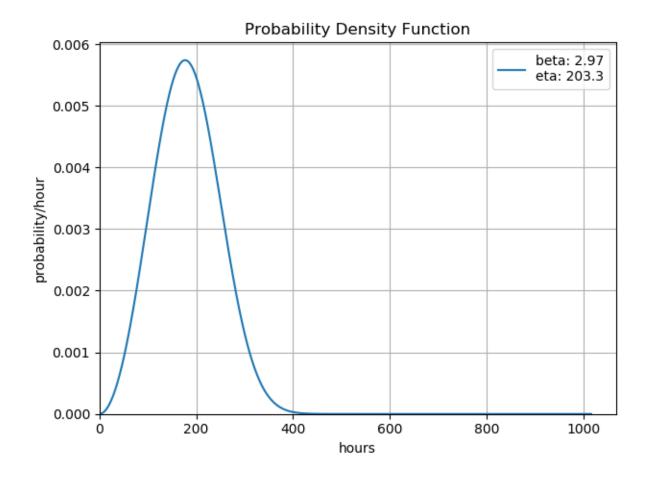

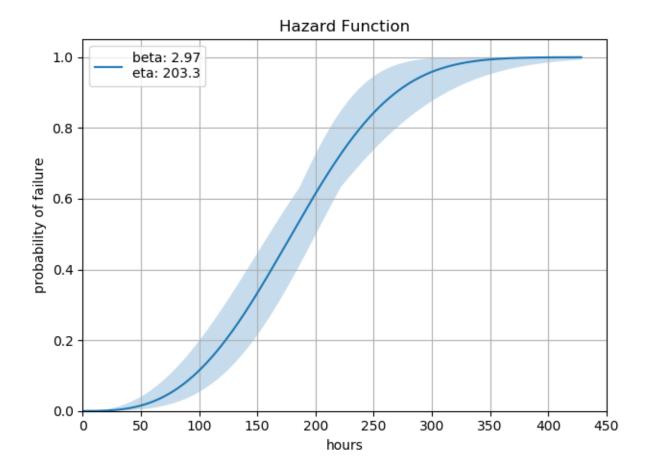

24 Chapter 6. Gallery

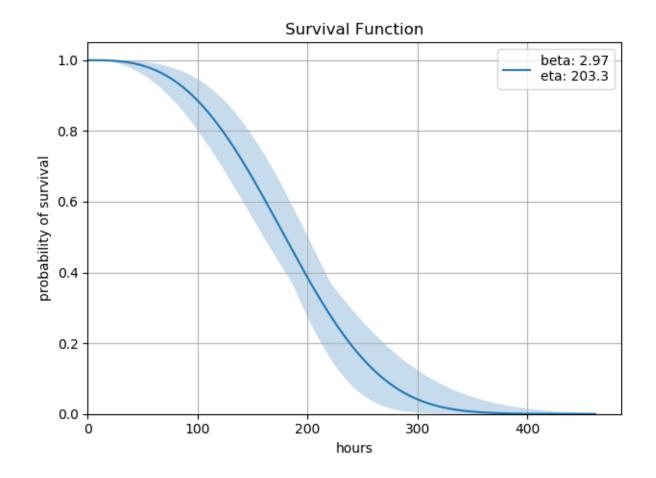

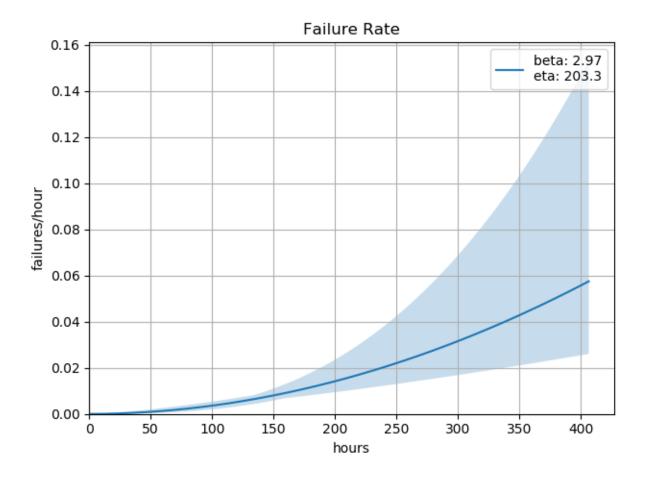

26 Chapter 6. Gallery

### Introduction to Reliability Analysis

### 7.1 Weibull Distribution

In reliability analysis and, thus, in the weibull package, we are primarily concerned with the 2-parameter Weibull probability density function defined herein as:

$$F(x) = \frac{\beta}{\eta} \left(\frac{x}{\eta}\right)^{\beta - 1} e^{-(x/\eta)^{\beta}}$$

where:


- $\beta$  or *beta* represents the **shape** parameter
- $\eta$  or *eta* represents the **scale** parameter
- $\bullet$  x represents the value at which the function is to be evaluated

Were one to plot the above F(x) with given  $\beta$  and  $\eta$  values, one would get the probability density function, commonly shortened to PDF. From the PDF alone, it is possible to derive the cumulative distribution function (a.k.a CDF and hazard functions), along with the survival function which is very useful in reliability engineering.


### 7.1.1 Distribution Shape

The **shape** parameter,  $\beta$ , determines the overall shape of the distribution. There are three primary regions in which  $\beta$  may fall:


- β < 1.0 Indicates infant mortality, or decreasing failures as time increases. This is a distribution that may be
  observed when a phenomenon such as adhesive curing exists. As the adhesive cures, the product experiences
  fewer failures.</li>
- $\beta = 1.0$  Indicates 'random' or 'constant' failures. This sort of distribution is most commonly applied to some electronic component categories, such as semiconductors.
- $\beta > 1.0$  Indicates a wearout style of distribution. This distribution is commonly observed on elements such as bearings which will increase their failure rate as wear increases.

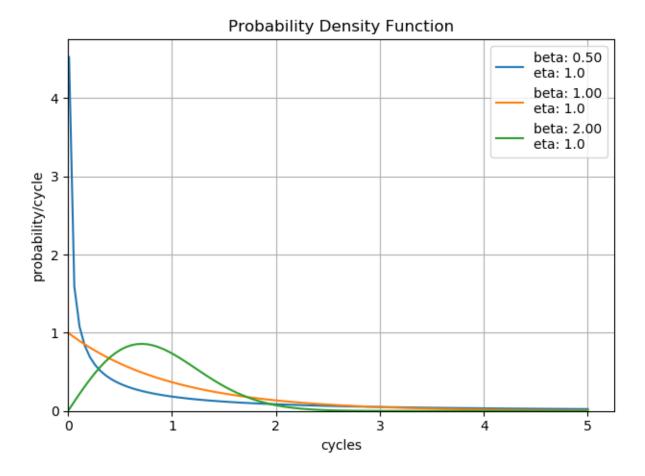

It is possible for a product to exhibit all three of these characteristics on different components. Imagine a car which has adhesives, electronics, and bearings, each of which have their own failure distributions. With careful analysis of the failure modes, it is possible to determine the individual component failure distributions, which allows the designer to potentially identify and resolve the most problematic elements of the design first.

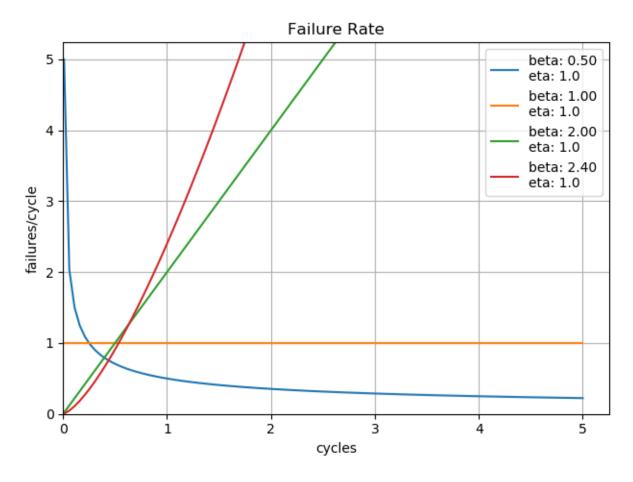


It is the combination of these three potentially different  $\beta$  characteristics that gives rise to the traditional bathtub curve commonly observed in reliability analysis. Looking closely at the plot of failure rates, one can see that a product composed of three different  $\beta$  characteristic components could begin to form an overall bathtub curve of the composite failure rates.

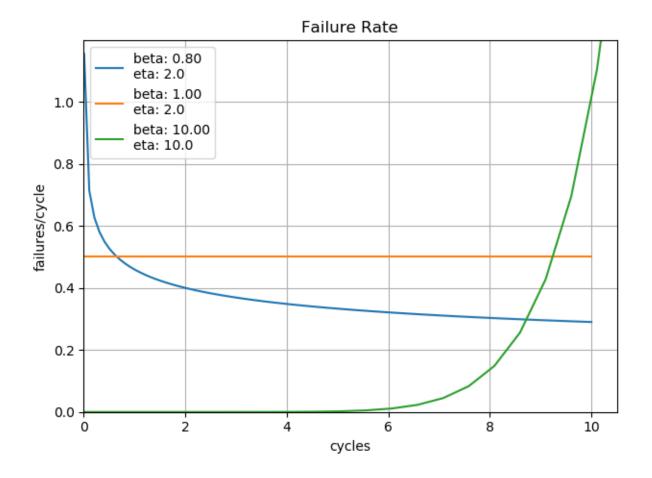

### 7.1.2 Distribution Scale

The **scale** parameter,  $\eta$ , determines the scale of the distribution. This parameter is also known as the *characteristic life* of the product and corresponds to the cycles at which 63% of the product has failed.

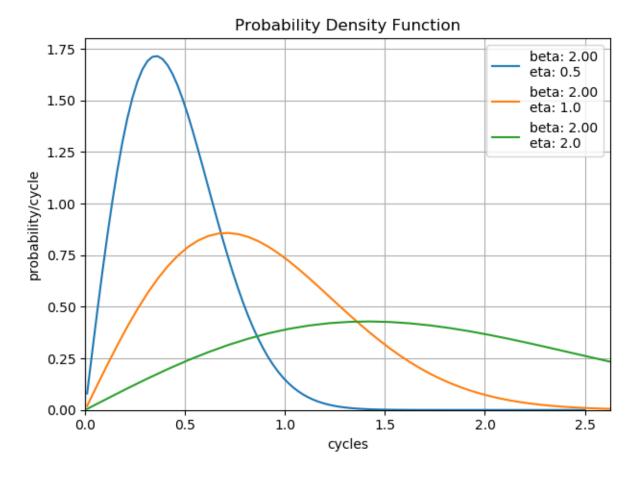

Note that changes in the scale factor keep the shape, but effectively change the length over which the distribution is 'stretched'. The change in height is due to the property that the area under the curve must always be equal to 1.0.

### 7.2 Censoring Data

For the reliability engineer, there are three possible scenarios for a batch of units:

- 1. All units are running with no failures
- 2. Some units have failed, but not all OR test was stopped before all units failed (right-censored)
- 3. All units have failed (not censored, or 'complete' data)

The Weibull distribution can handle scenarios 2 and 3 well, but failures are inherently part of the equation. If there are no failures, the best that can be expected is a lower estimate for the life.

### 7.3 Determining $\beta$ and $\eta$

The first task of the reliability engineer is to determine suitable values for  $\beta$  and  $\eta$ . The two most common options are:

- plot the points on Weibull paper, approximate a line, determine the slope and characteristic life
- maximum likelihood estimate (MLE)

7.2. Censoring Data

In general, if only a small number of data points are available, then the approximation using Weibull paper or its equivalent will generate good results. If there is a relatively large body of data available, then MLE methods are preferred. Both methods will generally give acceptable results, assuming that the Weibull distribution adequately describes the process.

Currently, this package uses the linear regression (LR) and maximum likelihood estimation (MLE) techniques for estimating  $\beta$  and  $\eta$ . Generally, MLE is preferred for larger data sets while LR is preferred for smaller data sets (less than 15). Examination of the fit is still essential in both methods to determine if the model actually fits the data appropriately.


### 7.4 B-Life

A common and effective method for specifying the life of a product is to specify the time when a certain portion of the units are expected to experience failure. This is often called the B-life of a product where B is followed by the number which specifies the percent of units failed. For instance, if one were to say that the B10 life of a product were 100 hours, then it would be expected that 10% of all units will have failed at 100 hours.

### 7.5 Confidence Levels

Now that you have some  $\beta$  and  $\eta$  values, what does that mean? How certain are you that  $\beta$  and  $\eta$  are what you have calculated? After all, there is almost certainly some level of variation in the data. Enter confidence limits. In short, most confidence limits on statistical data will assume a normal distribution to the right or the left of the curve. So, for instance, if you are looking at a probability plot, you assume that most of the points will be close to the line while some smaller number of points will be further from the line. The distance from the line will fall in a normal distribution straddling the line.

33

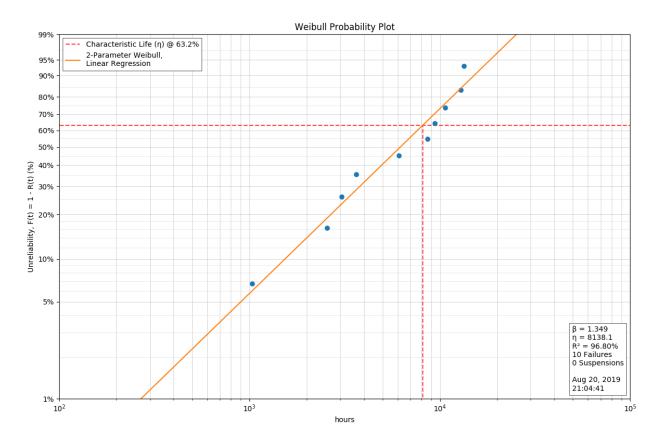

This package integrates confidence limits on the calculation of  $\beta$  and  $\eta$  such that the confidence limits define the range of certainty for  $\beta$  and  $\eta$  independently. For instance, if the confidence limit is 0.95, then our calculation is 95% certain that the true  $\beta$  falls between  $\beta_{lower}$  and  $\beta_{upper}$ . In addition, our calculation is 95% certain that the true  $\eta$  falls between  $\eta_{lower}$  and  $\eta_{upper}$ . The confidence limits are generally calculated when the curve is fitted.

The best way to increase the confidence limits is to gather more data. As more data is gathered, then the distributions of  $\beta$  and  $\eta$  are better defined.

7.5. Confidence Levels

# $\mathsf{CHAPTER}\, 8$

## Introduction

The weibull package is a package designed for easy reliability analysis using the weibull distribution. This documentation will not make a high effort to explain Weibull analysis but will, instead, focus on the use of the package. Despite this, there are still some obligatory convention to establish in order to make the documentation and packaging readable. Conventions are established in *Introduction to Reliability Analysis*.

### Installation

To install weibull into a Python 3 environment, simply pip3 install weibull. This package does *not* support Python 2.

## 9.1 Dependencies

The weibull package is built on pandas, numpy, matplotlib, and scipy libraries. If you are having trouble installing these libraries, particularly within windows, then you may wish to use the Anaconda distribution of Python.

## Test Coverage

The weibull package contains testing for the algorithmic elements of the analysis, but no testing for graphic generation.

### Classes

There are three primary classes available in weibull:

- $\bullet$  Analysis Used for analysis, you are probably wanting this
- Design Used for reliability test design
- Weibayes Used for analysis and design using some assumptions

genindex

42 Chapter 11. Classes

### Index

```
Α
                                                       S
Analysis (class in weibull), 7
                                                       sf() (weibull.Analysis method), 9
                                                       stats (weibull. Analysis attribute), 9
В
                                                       suspensions (weibull. Analysis attribute), 9
b() (weibull.Analysis method), 7
                                                       W
b () (weibull. Weibayes method), 13
                                                       Weibayes (class in weibull), 13
C
cdf () (weibull.Analysis method), 7
characteristic_life (weibull.Analysis attribute),
D
Design (class in weibull), 11
F
failures (weibull. Analysis attribute), 7
fit() (weibull.Analysis method), 7
fr() (weibull.Analysis method), 8
Η
hazard() (weibull.Analysis method), 8
M
mean (weibull.Analysis attribute), 8
median (weibull. Analysis attribute), 8
mttf (weibull.Analysis attribute), 8
Ν
num_of_cycles() (weibull.Design method), 12
num_of_units() (weibull.Design method), 12
Р
pdf () (weibull.Analysis method), 8
plot () (weibull. Weibayes method), 13
probplot() (weibull.Analysis method), 8
R
```

r\_squared (weibull.Analysis attribute), 9